

Source: Prestolite Leece-Neville Heavy Duty Systems
Bulletin No: TSB-1244 **Date:** June 20, 2024
Models: AVI160
Subject: Rectifier A051520700S, A051520308S, A051106192S



techservice@prestolite.com

To all Prestolite Electric customers:

- ⚠ A change was made to how the rectifier connects to the regulator.**
 Rectifiers A051520700S, A051520308S, A051106192S are no longer available, and are designed to connect to regulator R007520316S.
 To determine the correct service rectifier please refer to the list below.

Determine revision level of product.
 See fig. 1

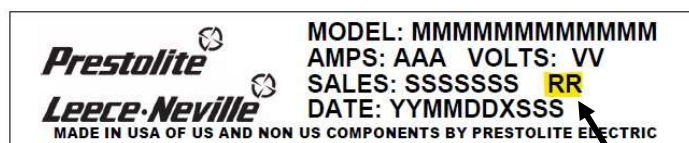


Fig 1

Revision Level

Model	Sales	Revision Level	Action
AVI160J2004	A160204	G and lower	Replace rectifier with A051521641S. Must use R007521645S regulator.
AVI160P2003	A160203	G and lower	Replace rectifier with A051521641S. Must use R007521645S regulator.
AVI160J2008	A160208	G and lower	Replace rectifier with A051106979S. Must use R007521645S regulator.
AVI160P2007	A160207	F and lower	Replace rectifier with A051106979S. Must use R007521645S regulator.
AVI160J2011	A160211	D and lower	Replace rectifier with A051106909S. Must use R007521645S regulator.
AVI160J2014	AVI2800J	D and lower	Replace rectifier with A051106909S. Must use R007521645S regulator.
AVI160P2010	A160210	C and lower	Replace rectifier with A051106909S. Must use R007521645S regulator.
AVI160P2012	AVI2800P	C and lower	Replace rectifier with A051106909S. Must use R007521645S regulator.

Important: The information contained in this bulletin is intended for use by trained, professional technicians who have the proper tools, equipment, and training to perform the required maintenance described above. This information is NOT intended for 'do-it-yourselfers', and you should not assume that this information applies to your equipment. If you have any questions regarding this information please visit our website at www.prestolite.com, or contact our technical service department at:



Technical Service: techservice@prestolite.com