

Source: Leece-Neville Heavy Duty Systems Division – Arcade, NY
Bulletin No: TSB-1205 **Date:** June 10, 2022
Models: 4900 pad mount self-excite
Subject: Terminal ID from 4900 self to AVI160

techservice@prestolite.com



Various 4900 series self-excite brush alternators can be replaced by AVI160 series brush alternators. See matrix below.

This document will help identify terminal location variances.

Note: Wire termination and routing will require changes.

4900 series alternators listed on this document are grounded earth return where the AVI160 series replacements are insulated return. Depending on the vehicle wiring a ground strap maybe required.

AVI160 series alternators has a pad mount bracket that uses a short span (108mm) where the 4900 series uses a span of (126mm). Most engine brackets have the ability to accommodate both spans. Please verify your engine bracket and refer to TSB-1049 for more information.


Model #	Voltage	Amperage	Substitute	Model #	Amperage
A0014939PGH Sales: 4949PGH	12	185	➔	AVI160P2007 A160207	210
A0014939PAH	12	185			

Important: The information contained in this bulletin is intended for use by trained, professional technicians who have the proper tools, equipment, and training to perform the required maintenance described above. This information is NOT intended for 'do-it-yourselfers', and you should not assume that this information applies to your equipment. If you have any questions regarding this information please visit our website at www.prestolite.com, or contact our technical service department at:



Bulletin No: TSB-1205

Date: June 10, 2022

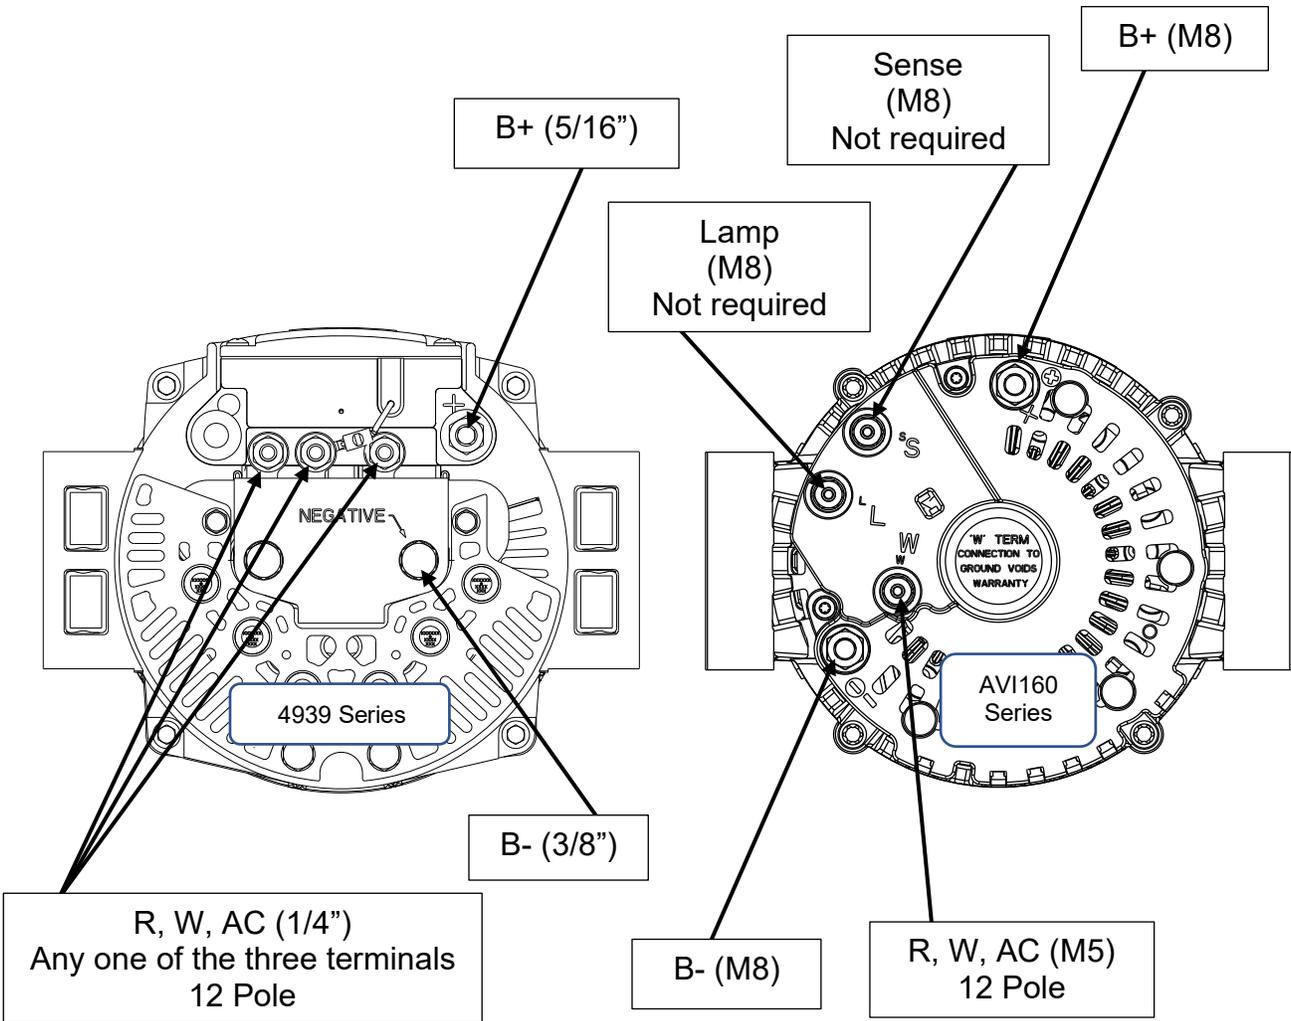

Important: The information contained in this bulletin is intended for use by trained, professional technicians who have the proper tools, equipment, and training to perform the required maintenance described above. This information is NOT intended for 'do-it-yourselfers', and you should not assume that this information applies to your equipment. If you have any questions regarding this information please visit our website at www.prestolite.com, or contact our technical service department at:

